CORRES. CONTROL LTR. NO.

K-H Corres. #

Originator Ltr Log #

AMT-022-9

97 - RF -		
DIST.	LTH	ENC
BARTHEL, J.M.	П	
BENGEL, P.R.	П	
BENSON, C.A.		
CARMEAN, C.H.	П	
DAWSON, D.		
EDWARDS, J.D.		_
FINDLEY, M.E.		
FITZ, R.C.	П	
GUINN, L.A.		
HUGHES, F.P.	П	_
MCANALLY, J.L.	П	_
POWER, A.P.	П	_
REED, A.B.	П	_
TYSON, A.M.	П	
WAGNER, M.J.		
WHEELER, M.	П	_
	П	
Bennski M	X	_
Blausseid M	V	_
Princes A	ΙŻÌ	_
	_	_

RF CORRES. CONTROL X TRAFFIC PATS/T130G

RMRS RECORDS (2)

CLASSIFICATION:

UCNI	
UNCLASSIFIED	
CONFIDENTIAL.	
SECRET	

AUTHORIZED CLASSIFIER SIGNATURE:

IN REPLY TO RF CC NO .:

ACTION ITEM STATUS: C) PARTIAL/OPEN □ CLOSED



y Flats Environmental Technology Site

30x 464

an, Colorado 80402-0464

(303) 966-7000

February 20, 1997

John A. Hill Vice President, ERWM&I Kaiser-Hill Company, Inc. P. O. Box 464, Bldg. 111 Golden, CO 80402-04640.

APPROVAL TO PERFORM PRE-REMEDIAL INVESTIGATION ACTIVITIES FOR THE MOUND SITE PLUME PROJECT - AMI-022-97

This letter requests approval to perform Pre-Remedial investigation activities for the Fiscal Year (FY) 97 Mound Site Plume, scheduled to commence the week of February 24, 1997. Activities include geoprobe investigations and ground water sampling to delineate the ground water plume derived from the Mound Site to design an appropriate treatment system.

Activities will be completed utilizing a project Health and Safety Plan, which includes activity specific Activity Hazard Analyses (Attachment 1). A soil disturbance permit has been issued in accordance with the site procedure, which included review and approval by Industrial Hygiene, Environmental Operations, Radiological Engineering, and the Plant Excavation Specialists (Attachment 2).

Your concurrence to initiate site preparation activities is required at this time. If you have any questions, the project staff is available to meet with you at your convenience. Thank you for your continued support of the RMRS Environmental Restoration Projects.

/Ilm

Ann M. Tyson Vice President, Environmental Restoration Rocky Mountain Remediation Services

ALP/aw

Attachments: As Stated

T. G. Hedahl, K-H, T130C A. K. Sieben, K-H, T130C J. Uhland, K-H. T130C



Health and Safety Plan Addendum PLANNED INTRUSIVE ACTIVITIES DURING FEBRUARY-MARCH 1997 NEAR THE SEEP SW059 SITE

(Addendum to Health and Safety Plan for the 1996 WARP, April 1996, RF/ER-96-0016)

Prepared by: Annette Rumered Annette Prince 1 Se. Peop Mar. 12/5/97/
Name Signature Title Date

Introduction.

This HASP addendum covers planned subsurface soil and groundwater sampling activities to be performed in the SW059 area from February through March 1997. The objective of this work is to identify an area for placement of a linear groundwater collection system to collect and treat groundwater contaminated with volatile organic compounds (VOCs). The Mound Area (IHSS 113) is thought to be the source for the contaminated groundwater plume.

This Addendum is only for the work to be conducted for the SW059 seep site characterization. The core recovery and groundwater collection program proposed per the SAP is designed to define the areal extent of the groundwater plume for construction of a groundwater collection and treatment system. The scope of this proposed activity is limited to soil core collection by the Geoprobe method with follow-up groundwater sampling. All sample analysis and interpretation will be the responsibility of RMRS. All activities described in this addendum will be conducted in accordance with this addendum, and the HSP for the 1996 WARP. The activities are substantially similar in scope and potential hazard as those described in the geotechnical boring subtask described in the WARP HSP. All activities described in this addendum will be performed by or at the direction of Environmental Restoration Projects personnel. Project contacts and emergency phone numbers are listed in Table 1.

Description of Planned Intrusive Activities.

A van mounted Geoprobe sampling rig will be used for sampling. The rig will be used to collect approximately twenty (20) one inch diameter soil cores up to a depth of approximately 15 feet. The equipment will be operated in accordance with procedure 4-S64-ER-OPS-GT.39 Push Subsurface Soil Sample. The direct push method employed by the rig will not generate waste cuttings or airborne dust. The soil samples will be enclosed in liners contained within the sampling assembly. The material within the liners will be containerized and preserved in accordance to the SAP. The containers can be transported directly to the analytical laboratories after screening for surface contamination, minimizing operator contact with potentially contaminated soils. These holes will be cased with PVC pipe after collection of the cores. Approximately 20 groundwater samples and 4 soil samples will be collected. Collection of groundwater samples will be performed under the Groundwater HASP.

Hazard Assessment.

Wildlife No wildlife hazards in addition to those addressed in the WARP HSP are anticipated as a result of the planned intrusive activities.

<u>Chemical and Radilogical</u> No hazards in addition to those addressed in the WARP HSP are anticipated as a result of the planned intrusive activities. This work involves potential contact with soil and/or water containing concentrations of chemicals in the parts per billion range. The risk associated with these levels is very low as these concentrations are one to three magnitudes below OSHA PELs. Site specific data provided in the attachment indicates no significant potential for hazardous levels of metal contamination in the subsurface soils to be sampled in the construction area. A table listing analytical data for the groundwater at the SW059 seep has been included as Table 2.

PPE requirements are the same as for the Planned Intrusive Activities during July-August, 1996 within the Mound Area, which are attached as Appendix A.

<u>Physical</u> Cold stress preventative guidelines detailed in the WARP HSP will be followed. The Geoprobe van wheels will be blocked during sampling operations and only the operator and helper will be allowed in the immediate vicinity of the vehicle. Borehole locations will be investigated for the presence of overhead and underground utility lines prior to the commencement of intrusive activities.


Radiological Contamination Monitoring/ Equipment Decontamination

Equipment used for intrusive sampling and well completion will be decontaminated to the extent possible within the work area. Radiological contamination monitoring will be performed for total fixed plus removable and removable alpha and beta/gamma contamination. If contamination levels are below

releasable limits, the equipment may then be released to the 891 Yard by the health and safety specialist (HSS). If additional decontamination is necessary the equipement will be transported to the Main Decontamination Facility for additional decontamination.

Project Organization

The following organization chart shows the project responsibilities.

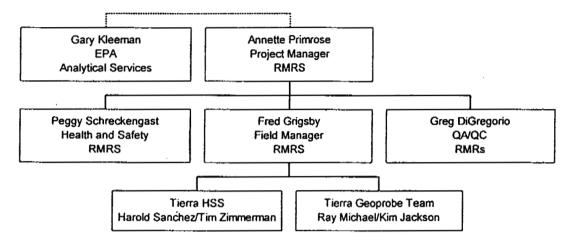

<u>Personnel</u>

Personnel monitoring and decontamination procedures as described in the WARP HSP remain in effect.

Approved by: M.C.Box	oussard MC	Signature E	R fis Ungk	<u>ට ට ට -</u> Date
Approved by: 1. Amb &	rson (Signature / Ra	Title	Z/N/G Date
Approved by: <u>M.D. Schre</u> Nar	ockengest M.D.S	Chreckengast / Health Signature	h <u>r Safety Supervisor</u> Title	<i>12 5 9</i> 7 Date

Table 1. Emergency Contact Telephone and Pager Numbers x. 2911

Fire Ambulance

x. 2911

Poison Center Security

629-1123 x. 2911

Nearest Emergency Medical Services Are Located At Building 122 as shown on the attached map.

Nearest telephone is located at:

T893 B

Additional Project Telephone Numbers

Vice President - ER - Ann Tyson x4829/d1101 H&S Manager - Ken Jenkins x5374/d7455 Project Manager - Annette Primrose x4385/d4675 Field Manager/Geologist - Fred Grigsby x7728/d7469 H&S Supervisor - Peggy Schreckengast x6790/d3059 HSS - Harold Sanchez/Tim Zimmerman x4953 **HAZMAT** Emergency Response x2911 Occupational Health General Information x2594

Note: d = digital page, the digital page system can be activated on plantsite by dialing extension 4000, then following the instructions.


I have read the contents of this HSP addendum, am familiar with the WARP HSP, and agree to comply with the contents within.

Name	Signature	Title	Date
			· ·
	·*		
<u> </u>			

SW059 Analytical Data

			3440.	as Milalyucai	Dala		•		
						Number	ALF GW Tier	ALF GW Tie	r
		Unit of	Minimum	Maximum	Average	of	I Action	II Action	1
Group Code	Chemical Name	Measure	Value	Value	Detect	Detects	Levels ug/l	Levels ug/	
Dis. Metals	ALUMINUM	UG/L	13.20	18.06	15,63	2	10,600,000	106,000	
Dis. Metals	ANTIMONY	UG/L	11.89	16.00	13.56	8	600	6	
Dis. Metals	BARIUM	UG/L	138	180	165.14	17	200,000	2,000	
Dis. Metals	CADMIUM	UG/L	1,90	3.00	2.59	4	500	5	
Dis. Metals	CALCIUM	UG/L	86,900	118,000	107,985	17			
Dis. Metals	COBALT	UG/L	1.71	1.71	1.71	1	219,000	2,190	
Dis. Metals	COPPER	UG/L	1,20	4.00	2.41	14	130,000	1,300	
Dis. Metals	IRON	UG/L	8,75	40.50	19.15	5			
Dis. Metals	LEAD	UG/L	0.91	5.40	2.59	3			
Dis. Metals	MAGNESIUM	UG/L	19,300	35,165	32,792.04	17			
							18 200	102	About Ties II
Dis. Metals	MANGANESE	UG/L	2.20	339,15	269.78	17	18,300	183	Above Tier II
Dis. Metals	NICKEL	UG/L	3.70	5.13	4.21	3	10,000	100	
Dis. Metals	POTASSIUM	UG/L	469	2,940	1,103.91	17			
Dis. Metals	SODIUM	UG/L	38,000	47,600	41,625.72	17			
Dis. Metals	THALLIUM	UG/L	4.60	4.60	4.60	1	200	2	Above Tier II
Dis. Metals	VANADIUM	UG/L	1.40	3.40	2.33	12	25,600	256	
Dis. Metals	ZINC	UG/L	49.10	232.00	144.77	17	1,100,000	11,000	
Tot. Metals	ALUMINUM	UG/L	58.70	21,000	1,778	14	10,600,000	106,000	
Tot Metals	ANTIMONY	UG/L			11.30	1	600	6	Above Tier II
			11.30	11.30					VIONE HELI
Tot. Metals	ARSENIC	UG/L	1.50	4.40	2.95	2	5,000	50	
Tot. Metals	BARIUM	UG/L	159.00	307.00	175.63	15	200,000	2,000	
Tot. Metals	BERYLLIUM	UG/L	1.00	1.00	1.00	1	400	4	
Tot. Metals	CALCIUM	UG/L	102,000	128,000	108,487	15			
Tot. Metals	CHROMIUM	UG/L	10.40	10.40	10.40	1	10,000	100	
Tot. Metals	COBALT	UG/L	3.50	3.50	3.50	1	219,000	2,190	
Tot. Metals	COPPER	UG/L	2.36	16.00	5.06	8	130,000	1,300	
Tot. Metals	IRON	UG/L	48.50		1,012.89	15	100,000	1,000	
Tot. Metals				12,100.00					
	LEAD	UG/L	2.20	23.20	7.27	5			
Tot. Metals	MAGNESIUM	UG/L	31,700	37,600	33,017	15			
Tot. Metals	MANGANESE	UG/L	258	1,440	387	15	18,300	183	Above Tier II
Tot. Metals	NICKEL	UG/L	3.80	13.80	7.30	3			
Tot. Metals	POTASSIUM	UG/L	653	2,570	1,051	15			
Tot. Metals	SELENIUM	UG/L	2.70	2.70	2.70	16	5,000	50	
Tot. Metals	VANADIUM	UG/L	1.60	24.80	4.44	12	25,600	256	
Tot. Metals	ZINC	UG/L	219	746	305	15	1,100,000	11,000	
Tot. Rads	AMERICIUM-241	PCI/L	0.25	0.25	0.25	1	14.5	0.145	Above Tier II
Tot. Rads	CESIUM-134	PCI/L	0.23	0.57	0.40	2	151	0.151	Above Tier II
Tot. Rads	GROSS ALPHA	PCI/L	4.20	10,87	8,59	14			
Tot. Rads	GROSS BETA	PCI/L	3.10	28.00	8.09	14			
Tot Rads	PLUTONIUM-238	PCI/L	0.01	0.01	0.01	1			
Tot Rads	PLUTONIUM-239/240	PCI/L	0.01	0.18	0.05	9	151	0.151	Above Tier II
Tot. Rads	RADIUM-226	PCI/L	0.63	0.63	0.63	1	2,000	20	
Tot. Rads	STRONTIUM-89,90	PCI/L	1.12	1.12	1,12	1	462		Strontium 89 only
Tot Rads	TRITIUM	PCI/L	82.17	82.17	82.17	i	66,600	666	,
Tot. Rads							00,000	000	*
TOU RAUS	URANIUM, TOTAL	UG/L	25	25	25	1			
Tot. Rads	URANIUM-233,-234	PCI/L	3.40	2.40	2.40		298	2.000	U233+D only Above Tier II
	•		3.40	3.40	3.40	1		2.980	ADOVE THEFT
Tot. Rads	URANIUM-235	PCI/L	0.10	0,10	0.10	1	101	1.010	
Tot. Rads	URANIUM-238	PCI/L	3.02	3.02	3.02	1	76.8	0.768	Above Tier II
VOA524.2	1,1,1-TRICHLOROETHANE	UG/L	0.10	9.00	1.82	17	20,000	200	
VOA524.2	1,1-DICHLOROETHANE	UG/L	0.30	2.00	0.54	15	101,000	1,010	
VOA524.2	1,1-DICHLOROETHENE	UG/L	0.30	5.00	0.94	11	700	7	
VOA524.2	1,2-DICHLOROETHANE	UG/L	1.00	1.00	1.00	1	500	5	
VOA524.2	CARBON TETRACHLORIDE	UG/L	3.00	130.00	33.94	6	500	5	Above Tier II
VOA524.2	CHLOROFORM	UG/L						100	Above Her II
VON324.2	CHECKOFORM	UG/L	2.00	25. 0 0	8.75	16	10,000	100	
									1,2 Dichloroethene
VOA524.2	cis-1,2-DICHLOROETHENE	UG/L	4.00	41.00	16.56	16	7,000	70	(total)
									-
VOA524.2	METHYLENE CHLORIDE	UG/L	0.10	18.00	2.74	7	500	5	Above Tier II
VOA524.2	NAPHTHALENE	UG/L	3	3	3	1	146,000	1,460	
VOA524.2	TETRACHLOROETHENE	UG/L	1.00	54.00	11.56	16	500	5	Above Tier II
VOA524,2	TRICHLOROETHENE	UG/L	1	76	16	16	500	5	Above Tier II
VOA524.2	TRICHLOROFLUOROMETHANE	UG/L	0.40	0.40	0.40	1			
VQA524.2	VINYL CHLORIDE	UG/L	0.70	3.00	1.68	4	200	2	Above Tier II
Water Qual.	BICARBONATE AS CACO3	MG/L	280	446	360	15		-	
Water Qual.	CARBONATE AS CACO3	MG/L	28	28	28	1			
Water Qual.									
	CHLORIDE	MG/L	33.60	81.50	65.04	16			
Water Qual.	FLUORIDE	MG/L	0.10	1.40	1,14	16			
Water Qual.	SULFATE	MG/L	27.00	48.90	60.19	15			
Water Qual.	TOTAL DISSOLVED SOLIDS	MG/L	470	609	532	15			
Water Qual.	TOTAL ORGANIC CARBON	MG/L	2.50	13,10	4.74	12			
Water Qual.	TOTAL SUSPENDED SOLIDS	MG/L	6	672	94	12			

RO	CKY MOUNTAIN REMED	ATION SERVICES
ACTIVITY HAZARD ANALYSIS	DEDOOT NUMBED.	
ACTIVITY HAZARD ANALTSIS	REPORT NUMBER.	
JOB/PROJECT:	SW059 Site Characterization	
	OVVOOD ONG ONGROCENZATION	
ACTIVITY DESCRIPTION:	Geoprobe soil cores and grou	ndwater sampling
	3	
Activity	Potential Hazard	Protective Control Measures
1) Geotechnical investigation		Pre-activity work area survey to identify potential
including soil cores and		hazards associated with operations. Hazard
groundwater sampling	Slips, trips, and falls	assessment per section 5.3.6.*
	Exposure to airborne	On-site monitoring requirements will be
	radioactive or chemical	established prior to project implementation per
	contaminants	section 6.0 and 7.0*.
	Dermal exposure with	
	radioactive or chemical	
	contaminants in soils and	Establish monitoring program prior to
	groundwater.	operations. Define appropriate level of PPE.
		Pre-work safety discussion and procedures
	Mechanical/hydraulic hazards	
	l	Hearing protection will be required during
	Noise exposure	geoprobe hammer operations.
		Clearances will be maintained per section
	Electrical hazards	5.3.2*.
	Underground/above-ground	Utility clearances will be performed per section
	utilities	5.3*.
	Cold stress/heat stress	Pre-work discussion to ensure awareness.
	Contact with potentially	Follow guidance in section 5.7*. Personal PPE will be defined prior to decon
2) Equipment decontamination	contact with potentially	operations
2) Equipment decontamination	Similar exposure hazards as	PPE and monitoring requirements consistent
	identified above.	with geotechnical operations.
	High pressure steaming, as	with geotechnical operations.
		PPE as described in section 8.0*.
H&S TRAINING:		
		1 10 1 400 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
SPECIAL EQUIPMENT:		
CRAFT FOREMAN CONCURRI	NCE: NA	
H&S CONCURRENCE:	M.D. Schrekenzust	246197
CONSTRUCTION SUPERINTE	NDANT CONCURRENCE:	annutt Purmoran 2/6/17
		·
refers to the	appropriate section in the WAF	RP 1996 HSP_RF/ER-96-0016

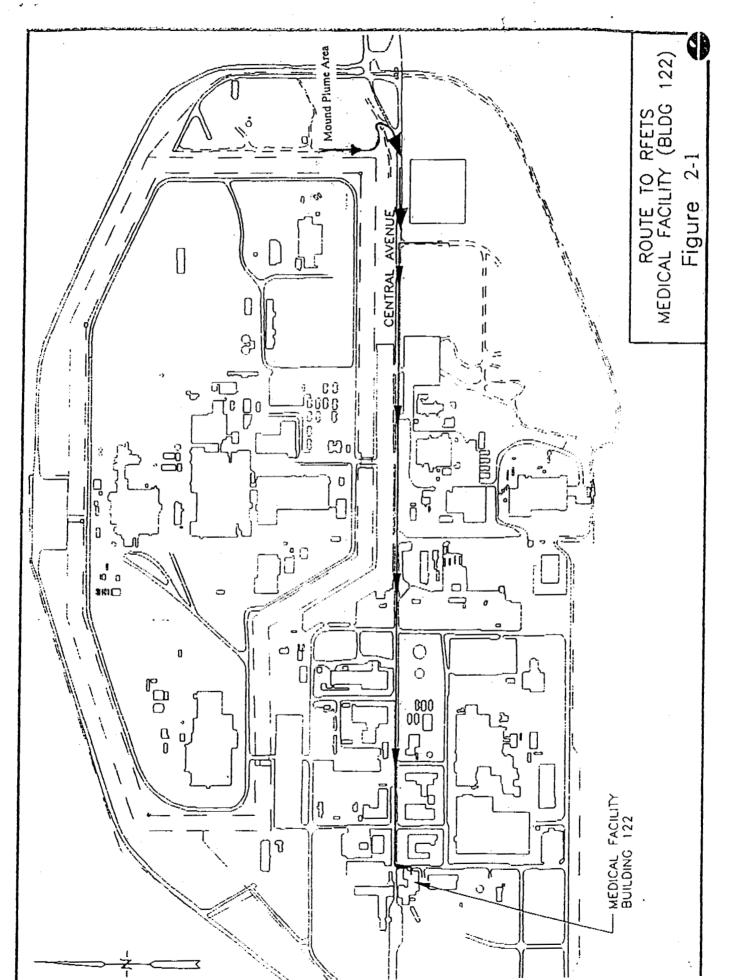

Date of the Report: 7/29/96

PLANNED INTRUSIVE ACTIVITIES DURING JULY AUGUST, 1996 Health and Safety . .. Jendum #2 WITHIN THE MOUND AREA A for Revised Ap

Site Location and Description:

Location: Mound Area, Formerly OU2 at SE Corner of the Protected Area (PA)

Description: Geoprobe Borings, collect soil gas, water and soil samples

Suspect Contaminates:

		···			3000	2
		Notes	Any existing hardens and an analysis with	Lan sastanted teauling above background in the BZ	. Det compol (misting) will be used above 3 is mill and p	· ¥5
		Level B	•		¥	4
	ACTION LEVELS IN BZ	Level C	NA		米令	
		Level D Modified	0 ppm		·100 mg/m³[0-2.5 mg/m³] 米 多 一 *	
	٩	Range	0-2000 ppm	l	ς.	
		Instrument	O.G.		10 mg/m² MIE Miniram	
	JIREMENTS	PEL		•	10 mg/m²	
10010	MONITORING REQUIREMENTS	•	Hydrocarbons		raniculates	

Personal Monitoring:

Analytical Method NIOSH Methods Monitor for VOAs using personal sampling methods, if neccessary, upgrade for respiratory Contaminant

Nowe foul

7-30-96

Personal Protective Equipment:

Type of Work	Level D	Level D Modified	Coveralls	Saranex	Nitrile	Silvershield	Latex	Face	Rubber	Full-Face	
(1)			200	2000	CIOVES	cioves	Cloves	Shields	Apron	Respirator	
Geoprope - Soil Gas Sampling	×				×		,				
Georgia Grandania (1)	;									-	
Scoploge Clouridwaler Sarripitrig	×				×		,				
Cooperate Coil Complian (1)							~				
Geoplope - Soil Samplifing	×				×		,				
(1) If high Was reading or free liquids							·				_
(1) Ingr. vons teaching of the inquires are encountered personal will upgrade to Saranex and Face Shields. Sustained readings of Vince in the proof.	are encour	nered persona	II WIII upgrade t	o Saranex an	d Face Shi	elds. Sustaine	d readings	of VOCe in	the headth		
require backing off and allowing samples to vent. If workers	les to vent.	f workers mus	work where V	OC readings	ciclores or o	od in the	S		יום מומפוו	ilig zone wili	
respiratory protection will be used			The prescription of the state of the state of the prescription of the state of the	200	מות פספומנו	en in ine orea	ining zone,	work will s	top and su	pplied air	

Notes:

PEL = Permissible Exposure Limit PID = photoionization detector ppm = parts per million

NIOSH = National Institute for Occupation Safety and Health

PPE = personal protective equipment NA ≈ not applicable

mg/m³ = milligrams per cubic meter

ROCKY FLATS SOIL DISTRUBANCE APPROVAL FORM

LOCA	ATION/PROJECT TIT	LEWORK DESC	RIPTION <u>GEC</u>	PROBE SI	05 A59	
CONT	TRACTOR:	es	AU	TH/CHARGE N	0: NH530	050
LOG	NO: 1-1-4-9	<u>s-</u>	DRAWING	3 NO.: <u>/6757</u>	1-24	OUS Phous
CAU	TIONS/SPECIAL INS	TRUCTIONS:	60"SD-CA	1P, 4" D.	IP-CI 2"	GN . STL
DIST	RUBANCE LIMITS (I	DURATION/BOU	NDAYR):'/-	14-97	J40	
RES	PONSIBLE JOB SUF	PERVISOR:	L Promu	34		
OPE	ERATOR/WORKERS(s):[<i>[4]ji/Y</i> [richael.	Kmi J.	1-, The	4. May /
	nothy & juneous		Dung	ly		
EXC	AVATION SPECIALIS	ST A. Yeur	E. Trade	<u></u>	DA1	E: <u>3.14.17</u>
		EXCA	VATION EN	TRY APPR	OVAL	
OSH	HA SOIL CLASS:	A	□ в (ļ.	
ITIAL SA	FETY INSPECTION	BY:			D	ATE:
			DAILY INS	PECTIONS	<u>:</u>	
	INITIALS	DATE	INITIALS	DATE	INITIALS	DATE
			-			
		*				
- 1						